

# Quarter Outer Panel Sectioning


## Removal Procedure

**Caution:** Refer to [Approved Equipment for Collision Repair Caution](#) in Cautions and Notices.

**Caution:** Sectioning should be performed only in the recommended areas. Failure to do so may compromise the structural integrity of the vehicle and cause personal injury if the vehicle is in a collision.

The body side outer panel is available in one piece. You can perform any one of these replacement procedures separately or in any combination, depending upon the extent of damage to the vehicle. Sectioning must take place in specified areas only. Stay away from the door and window opening radius areas. Section only in straight areas of the openings.

1. Disable the SIR system. Refer to [SIR Disabling and Enabling](#) .
2. Disconnect the negative battery cable. Refer to [Battery Negative Cable Disconnection and Connection](#) .
3. Remove all related panels and components.
4. Repair as much of the damaged area as possible. Refer to [Dimensions - Body](#) .
5. Remove the sound deadeners as necessary. Note their location.
6. Remove the sealers and anti-corrosion materials from the repair area, as necessary. Refer to [Anti-Corrosion Treatment and Repair](#) .

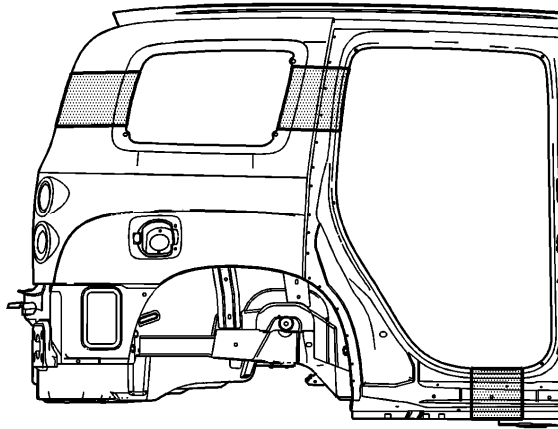

**Important:**

- Perform sectioning only in the recommended areas of the rocker panel and pillars.
- Avoid areas in the radius corners for the rear header attachment locations.
- Avoid areas in the radius corners, at the bottom of the quarter window and at the bottom of the dogleg in the door opening.


7. Sectioning can be performed at any of the following locations:

- Any straight area along the bottom of the rear door opening forward of the rear corner radius and rearward of the center pillar radius. Use a 100 mm (4 in) welding backer.
- Any straight area along the front quarter window opening. Use a 50 mm (2 in) weld backer.
- Any straight area along the rear quarter window opening. Use a 50 mm (2 in) weld backer.

10. Within the recommended sectioning areas, mark the location of the sectioning cut lines on the vehicle.


**Important:** Note the number and location of the factory welds for installation of the quarter panel.

11. Locate and drill out all factory welds.

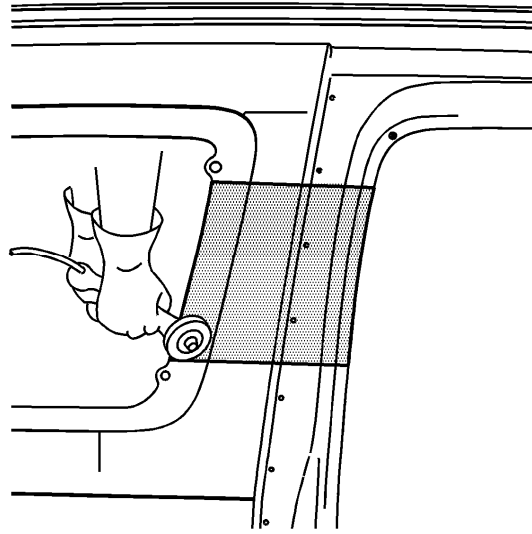

**Important:** Do NOT damage any other panels or reinforcements when cutting at the marked locations.

12. Cut the panel at the locations laid out in the previous steps.

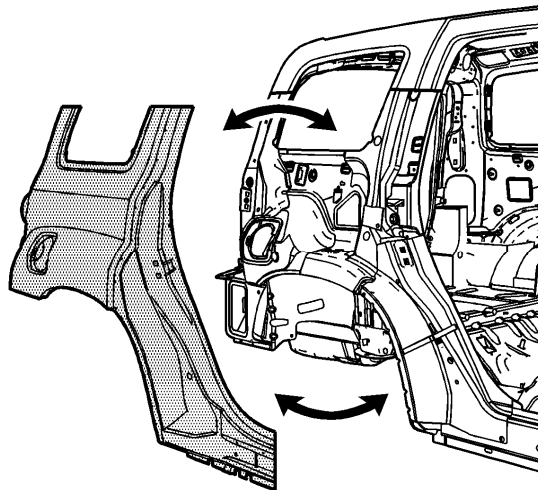


13. Remove the damaged quarter panel.

## [Installation Procedure](#)

**Important:** To allow proper layout and cutting of the service port, review the appropriate sectioning area information in the removal procedure.


1. Locate the area on the service panel where you will perform sectioning.
2. Measure and mark the cut line location on the service part.

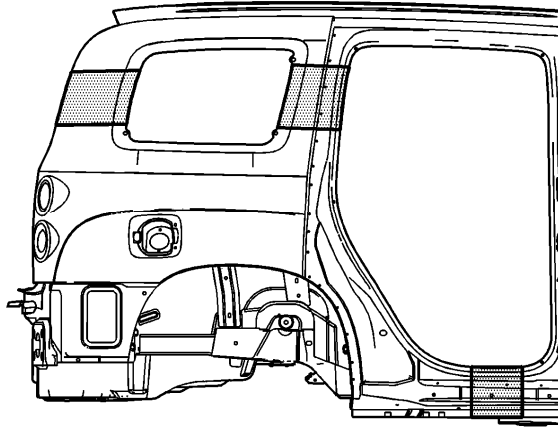

3. Cut the service panel in corresponding locations to fit the remaining original panel. Trim the sectioning butt joint to allow a gap of 1½ times the metal thickness at the sectioning joint.
4. Create backing plates of the specified length from the unused portion of the service part.
5. Trim the backing plates as necessary to fit behind the panel at the sectioning joints.

**Important:** If the location of the original plug weld holes can not be determined, space the plug weld holes every 40 mm (1½ in) apart.

6. Drill 8 mm (5/16 in) plug weld holes along the sectioning areas in the service part. Drill the plug weld holes 15 mm (5/8 in) from the edges.
7. Drill 8 mm (5/16 in) plug weld holes at the locations noted from the original panel.
8. Prepare all mating surfaces as necessary.
9. Apply GM-approved Weld-Thru Coating or equivalent to all mating surfaces. Refer to [Anti-Corrosion Treatment and Repair](#) .
10. Fit the backing plates halfway into the sectioning joints on the vehicle. Clamp the plates in place, and plug weld to the section joint
11. Weld the plug weld holes on the vehicle half of the backing plates.
12. Position the quarter panel service part to the vehicle using 3-dimensional measuring equipment. Clamp the quarter panel in place.

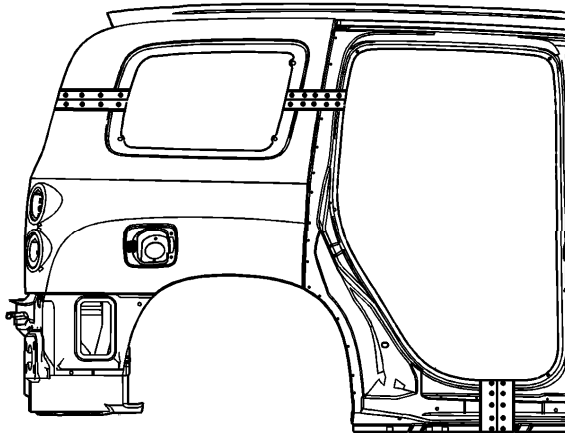

13. Plug weld accordingly.
14. To create a solid weld with minimum heat distortion, make a 25 mm (1 in) stitch weld along the seam with gaps of 25 mm (1 in). Go back and complete the stitch weld.
15. Clean and prepare all of the welded surfaces.
16. Apply the sealers and anti-corrosion materials to the repair area, as necessary.  
Refer to [Anti-Corrosion Treatment and Repair](#) .
17. Paint the repaired area. Refer to [Basecoat/Clearcoat Paint Systems](#) .
18. Install all of the related panels and components.
19. Connect the negative battery cable. Refer to [Battery Negative Cable Disconnection and Connection](#) .
20. Enable the SIR system. Refer to [SIR Disabling and Enabling](#) .